


Maria del Pilar Noriega E.
Chris Rauwendaal

Troubleshooting the Extrusion Process

A Systematic Approach to Solving
Plastic Extrusion Problems

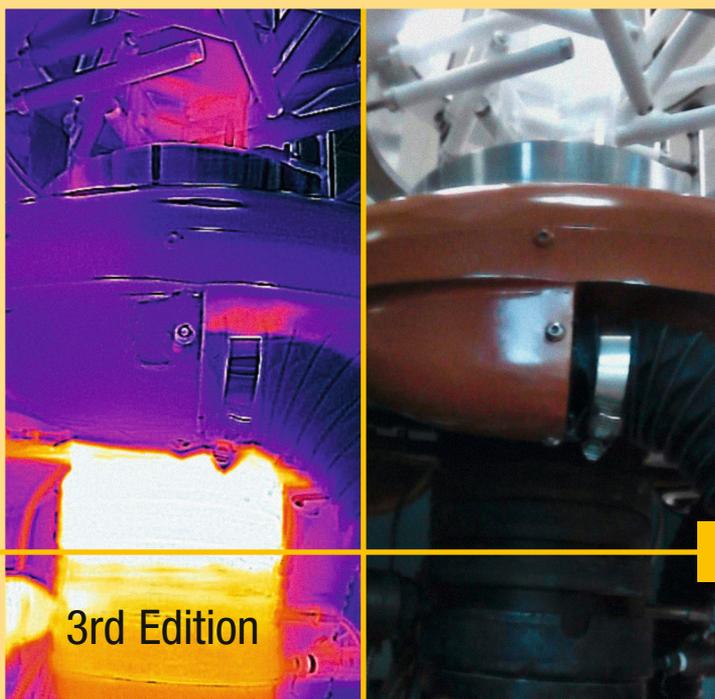

HANSER

Noriega / Rauwendaal
Troubleshooting the Extrusion Process

Maria del Pilar Noriega E.
Chris Rauwendaal

Troubleshooting the Extrusion Process

A Systematic Approach to Solving Plastic
Extrusion Problems

3rd Edition

Hanser Publishers, Munich

HANSER
Hanser Publications, Cincinnati

The Authors:

Maria del Pilar Noriega E., Calle 16 A Sur No. 29 B - 40, Medellin, Colombia, South America

Chris Rauwendaal, 10556 Combie Rd PMB 6677 Auburn, CA 95602-8908, USA

Distributed in the Americas by:

Hanser Publications
414 Walnut Street, Cincinnati, OH 45202 USA
Phone: (800) 950-8977
www.hanserpublications.com

Distributed in all other countries by:

Carl Hanser Verlag
Postfach 86 04 20, 81631 Munich, Germany
Fax: +49 (89) 98 48 09
www.hanser-fachbuch.de

The use of general descriptive names, trademarks, etc., in this publication, even if the former are not especially identified, is not to be taken as a sign that such names, as understood by the Trade Marks and Merchandise Marks Act, may accordingly be used freely by anyone. While the advice and information in this book are believed to be true and accurate at the date of going to press, neither the authors nor the editors nor the publisher can accept any legal responsibility for any errors or omissions that may be made. The publisher makes no warranty, express or implied, with respect to the material contained herein.

The final determination of the suitability of any information for the use contemplated for a given application remains the sole responsibility of the user.

Library of Congress Control Number: 2019946876

All rights reserved. No part of this book may be reproduced or transmitted in any form or by any means, electronic or mechanical, including photocopying or by any information storage and retrieval system, without permission in writing from the publisher.

© Carl Hanser Verlag, Munich 2019

Editor: Dr. Julia Diaz Luque

Production Management: Jörg Strohbach

Coverconcept: Marc Müller-Bremer, www.rebranding.de, Munich

Coverdesign: Max Kostopoulos

Typesetting: Kösel Media GmbH, Krugzell

Printed and bound by Hubert & Co. GmbH und Co. KG BuchPartner, Göttingen

Printed in Germany

ISBN: 978-1-56990-775-7

E-Book ISBN: 978-1-56990-776-4

Acknowledgments

From author **Chris Rauwendaal**:

I want to thank my family for their continuing support and patience when I work on these time-consuming projects. I would also like to thank the hundreds of companies I have worked with. Each troubleshooting problem is not only a challenge but also an opportunity to learn. After working in the extrusion industry for over 45 years I have had the good fortune to learn more than I ever expected. Also, I would like to thank the thousands of people that have attended my extrusion seminars. I have found that the best way to learn a subject well is to teach it – this is one of many enjoyable and rewarding aspects of teaching. In most seminars there is very good interaction. As a result, not only the attendees learn from the instructor but the instructor also learns from the attendees – truly a win-win situation.

I would like to acknowledge Verena Resonnek at the department of Kunststofftechnik Paderborn, University of Paderborn, Germany for providing information on the development of a controller capable of automatic optimization of extruder barrel temperatures.

Author **Maria del Pilar Noriega Escobar** thanks her husband, family, and best friends for their valuable support and patience during all these years of applied research, industrial applications, and innovation in polymer processing. She is grateful to Mr. Hans Udo Steinhäuser, President of the Plastics and Rubber Research Institute (ICIPC) and her Institute's colleagues for their support during the preparation of this book.

Norberto Montoya is acknowledged for micrographs in the first edition and Juan Carlos Gallego for micrographs in the second edition.

Eberhard Grünschloss from IKT (Institut für Kunststofftechnik, Stuttgart) and Tim Andreas Osswald (UW-Madison) are acknowledged for the valuable discussions and, finally, Diana María Angel is gratefully acknowledged for the figures in the three editions.

Preface

One of the greatest challenges in actual extrusion operations is efficient and rapid problem-solving. Extrusion problems often result in downtime and/or out-of-spec product, and this can be very costly. However, because of the nature of the extrusion process, it is often quite difficult to determine the cause of the problem and find the proper solution, particularly if it must be done quickly. Despite the industrial importance of extrusion troubleshooting, no book currently deals exclusively with this topic. This book is an attempt to rectify this situation.

Both authors have worked in extrusion for many years and have been involved in numerous troubleshooting projects. Although it is impossible to discuss all possible extrusion problems, it is possible to discuss the main categories and to develop a systematic and methodical approach to solving extrusion problems. In this book, the authors frequently use flow charts and fishbone charts to allow systematic troubleshooting.

The authors added a substantial amount of new material to this third edition, including:

- Chapter 1: new section on collection and interpretation of extrusion process data
- Chapter 2: data acquisition systems section substantially expanded and updated with cloud-based DAS and systems that can automatically detect machine problems; new sections on rotational rheometry and the smartphone
- Chapter 3: new sections covering how screw design can affect extruder performance and melt temperature variation; additionally, barrel temperature profiles for many polymers from LDPE to PEEK
- Chapter 4: ten new case studies
- Appendix 3: new section with information on barrel temperature optimization for PP and HDPE for a 2.5-inch (63.5 mm) extruder and a description of recent research on automatic optimization of extruder barrel temperatures conducted at the department of Kunststofftechnik Paderborn, University of Paderborn, Germany by Verena Resonnek

- Appendix 4 (new): process signal analysis using Fast Fourier Transform

The authors welcome feedback from readers, along with additional material on extrusion troubleshooting. This will allow more information to be incorporated into future editions of this book.

List of Acronyms

ABS	Acrylic-butadiene-styrene copolymer
BTP	Barrel temperature profile
DAS	Data acquisition system
DOE	Design of experiments
FPVC	Flexible polyvinylchloride
HDPE	High density polyethylene
L/D	Length to diameter ratio
LDPE	Low density polyethylene
LLDPE	Linear low density polyethylene
OTE	One-at-a-time experiments
PC	Polycarbonate
PE	Polyethylene
PEEK	Polyether ether ketone
PET	Polyethylene terephthalate
PMMA	Polymethyl methacrylate (acrylic)
PP	Polypropylene
PS	Polystyrene
PVC	Polyvinylchloride
RPVC	Rigid polyvinylchloride
SPC	Statistical process control

Contents

Acknowledgments	V
Preface	VII
List of Acronyms	IX
1 Requirements for Efficient Troubleshooting	1
1.1 Instrumentation	1
1.2 Understanding the Extrusion Process	2
1.3 Collection and Analysis of Historical Data (Time Line)	4
1.4 Team Building	5
1.5 Condition of the Equipment	6
1.6 Information about the Feed Stock	6
1.7 Problem-Solving Techniques	8
1.8 Collection and Interpretation of Extrusion Process Data	9
1.8.1 Introduction	9
1.8.2 Vital Signs of the Extrusion Process	9
1.8.2.1 Melt Pressure	10
1.8.2.2 Melt Temperature	16
1.8.2.3 Training	25
1.8.3 Conclusions	25
2 Tools for Troubleshooting	27
2.1 Temperature Measurement Devices	27
2.2 Data Acquisition Systems	28
2.2.1 Portable Data Collectors/Machine Analyzers	29
2.2.2 Fixed-Station Data Acquisition Systems	30
2.3 Light Microscopy	33

2.4	Thermochromic Materials	34
2.5	Thermal Analysis, IR Spectroscopy, and Rheometry	35
2.5.1	Differential Thermal Analysis and Differential Scanning Calorimetry	35
2.5.2	Thermogravimetric Analysis	37
2.5.3	Fourier Transform Infrared Spectroscopy	38
2.5.4	Thermomechanical Analysis	39
2.5.5	Torque Rheometry	40
2.5.6	High Pressure Capillary Rheometry	41
2.5.7	Rotational Rheometry	43
2.5.8	Other Thermal Characterization Techniques	46
2.6	Miscellaneous Tools	46
2.6.1	Infrared Thermography	47
2.6.2	The Smartphone	48
2.6.3	Power Measurements	49
3	Systematic Troubleshooting	51
3.1	Upsets versus Development Problems	51
3.2	Machine-Related Problems	51
3.2.1	The Drive System	52
3.2.2	The Feed System	53
3.2.3	The Heating and Cooling System	53
3.2.4	How Screw Design Can Affect Extruder Performance	54
3.2.5	Wear Problems	65
3.2.5.1	Wear Mechanisms	66
3.2.5.2	Test Methods for Wear	67
3.2.5.3	Causes of Wear	72
3.2.5.4	Solutions to Wear Problems	77
3.2.5.5	Rebuilding Worn Screws and Barrels	83
3.2.6	Screw Binding	87
3.2.6.1	Extrusion of Fluoropolymers	88
3.2.6.2	The Mechanics of Screw Binding	88
3.2.6.3	Changes in Clearance Due to Temperature Differences	88
3.2.6.4	Analysis of Temperature Distribution in Extruder Screws	91
3.2.6.5	Change in Clearance Due to Compressive Load	92
3.2.6.6	Results from Analysis	92
3.3	Polymer Degradation	93
3.3.1	Types of Degradation	93
3.3.1.1	Thermal Degradation	94

3.3.1.2	Mechanical Degradation	94
3.3.1.3	Chemical Degradation	96
3.3.2	Degradation in Extrusion	97
3.3.2.1	Residence Time Distribution	97
3.3.2.2	Temperature Distribution Simple Calculations	101
3.3.2.3	Temperature Distribution Numerical Calculations	107
3.3.2.4	Reducing Degradation	114
3.4	Extrusion Instabilities	115
3.4.1	Frequency of Instability	116
3.4.1.1	High-Frequency Instabilities	117
3.4.1.2	Screw Frequency Instabilities	120
3.4.1.3	Low-Frequency Instabilities	122
3.4.1.4	Very Slow Fluctuations	123
3.4.1.5	Random Fluctuations	123
3.4.2	Functional Instabilities	124
3.4.2.1	Solids-Conveying Instabilities	125
3.4.2.2	Plasticating Instabilities	125
3.4.2.3	Melt-Conveying Instabilities	126
3.4.2.4	Devolatilization Instabilities	126
3.4.2.5	Mixing Related Instabilities	127
3.4.2.6	Distributive Mixing Sections	127
3.4.2.7	Dispersive Mixing Sections	132
3.4.2.8	Solving Mixing Problems	139
3.4.2.9	Melt Temperature Variation	140
3.4.3	Solving Extrusion Instabilities	149
3.5	Air Entrapment	151
3.6	Gel Problems	153
3.6.1	Measuring Gels	153
3.6.2	Gels Created in the Extrusion Process	154
3.6.3	Removing Gels Produced in Polymerization	155
3.7	Die-Flow Problems	156
3.7.1	Melt Fracture	156
3.7.2	Die-Lip Buildup (“Die Drool”)	158
3.7.3	V- or W-Patterns	159
3.7.4	Specks and Discoloration	160
3.7.5	Lines in Extruded Product	161
3.7.5.1	Weld Lines	162
3.7.6	Optical and Appearance Properties	163

4 Case Studies	165
4.1 Film Coextrusion – Degradation in the Middle Layer	165
4.1.1 Description of the Problem	165
4.1.2 Analysis of the Problem	166
4.1.3 Solution	167
4.2 Film Coextrusion with Interfacial Problems	169
4.2.1 Description of the Problem	169
4.2.2 Analysis of the Problem	169
4.2.3 Solution	170
4.3 Lines in the Extruded Film	170
4.3.1 Description of the Problem	170
4.3.2 Analysis of the Problem	171
4.3.3 Solution	172
4.4 Color Variation in Polypropylene Carpet Fiber	172
4.4.1 Description of the Problem	172
4.4.2 Analysis of the Problem	173
4.4.3 Solution	174
4.5 Plastic Film with Poor Transparency	175
4.5.1 Description of the Problem	175
4.5.2 Analysis of the Problem	176
4.5.3 Solution	177
4.6 Wear Problem in Film Extrusion	178
4.6.1 Description of the Problem	178
4.6.2 Solution	178
4.7 Multilayer Film – Several Appearance Problems	179
4.7.1 Description of the Problem	179
4.7.2 Analysis of the Problem	179
4.7.3 Solution	180
4.8 Dispersion Problem in a High-Density Polyethylene Bottle	181
4.8.1 Description of the Problem	181
4.8.2 Analysis of the Problem	181
4.8.3 Solution	182
4.9 Polymer Degradation	184
4.9.1 Description of the Problem	184
4.9.2 Analysis of the Problem	184
4.9.3 Solution	185
4.10 Heat-Sealing Problems in a Coextruded Film	187
4.10.1 Description of the Problem	187
4.10.2 Analysis of the Problem	188
4.10.3 Solution	189

4.11	Output Problem in a Blown Film Line	190
4.11.1	Description of the Problem	190
4.11.2	Analysis of the Problem	190
4.11.3	Solution	192
4.12	Masterbatch Selection	193
4.12.1	Description of the Problem	193
4.12.2	Analysis of the Problem	194
4.12.3	Solution	195
4.13	Pipe Extrusion Problem	196
4.13.1	Description of the Problem	196
4.13.2	Analysis of the Problem	196
4.13.3	Solution	197
4.14	Gel Formation in a Coextruded Film	199
4.14.1	Description of the Problem	199
4.14.2	Analysis of the Problem	199
4.14.3	Solution	200
4.15	Agglomerates and Grammage Variation in a PP Sheet	200
4.15.1	Description of the Problem	200
4.15.2	Analysis of the Problem	201
4.15.3	Solution	203
4.16	Insufficient Melting and Mixing in a Plasticating Unit	204
4.16.1	Description of the Problem	204
4.16.2	Analysis of the Problem	205
4.16.3	Solution	207
4.17	High Melt Temperature and Insufficient Output in Coextrusion	208
4.17.1	Description of the Problem	208
4.17.2	Analysis of the Problem	209
4.17.3	Solution	210
4.18	Deficient Solids Conveying and Dispersion	213
4.18.1	Description of the Problem	213
4.18.2	Analysis of the Problem	213
4.18.3	Solution	215
4.19	Instability of Formation at the Die	216
4.19.1	Description of the Problem	216
4.19.2	Analysis of the Problem	217
4.19.3	Solution	219
4.20	Intermittent Pumping in a Vented Extruder	222
4.20.1	Description of the Problem	222
4.20.2	Analysis of the Problem	223
4.20.3	Solution	225

4.21 Melt Fracture or Sharkskin in m-PE	227
4.21.1 Description of the Problem	227
4.21.2 Analysis of the Problem	227
4.21.3 Solution	228
4.22 Scale-up of LLDPE Single Screw Extruder	229
4.22.1 Description of the Problem	229
4.22.2 Analysis of the Problem	229
4.22.3 Solution	230
4.23 Non-homogeneous Melt in Blow Molding	232
4.23.1 Description of the Problem	232
4.23.2 Analysis of the Problem	232
4.23.3 Solution	232
4.24 High Melt Temperature in Sheet Extrusion	234
4.25 Gear Pump Speed Variation in Sheet Extrusion	238
4.26 Melt Temperature Variation in Tubing Extrusion	244
4.27 Black Specks in Tubing Extrusion	247
4.28 Mechanical Degradation in TPE Extrusion	252
4.29 Degradation in a Long Adapter	255
4.30 Shrink Voids in Rod Extrusion	258
4.31 Improper Preheating of Extruders	268
Appendix 1: Systematic Problem Solving	285
Appendix 2: Machine Troubleshooting and Maintenance	287
A2.1 Check the Oil	287
A2.2 Unusual Noises	288
A2.3 Vibration Monitoring	288
A2.4 Drive Motors and Belts	289
A2.5 Spare Parts	290
A2.6 Screw and Barrel	290
A2.7 Extruder Maintenance Checklist	291
Appendix 3: Extruder Barrel Temperatures	295
A3.1 Setting Extruder Barrel Temperatures	295
A3.2 Extruder Barrel Temperature Profile Optimization	296
A3.2.1 Introduction	296
A3.2.2 Facts about Barrel Temperature Profile (BTP)	296

A3.2.3 Typical Process Temperatures for Different Plastics	298
A3.2.4 Guidelines and Considerations for Setting Barrel Temperatures	299
A3.2.5 BTP Optimization by Design of Experiments (DOE)	304
A3.2.6 BTP Optimization by One-at-a-Time Experiments (OTE)	305
A3.2.7 Dynamic BTP Optimization	305
A3.2.8 Other Studies on Optimization of Extruder Barrel Temperature Profiles	307
A3.2.9 Conclusions	321
Appendix 4: Process Signal Analysis Using Fast Fourier Transform	323
References	335
Index	347

1

Requirements for Efficient Troubleshooting

Before acting on a specific extrusion problem, the troubleshooter should address certain issues. It is important to diagnose a developing extruder problem quickly and accurately to minimize downtime or off-quality product. Good instrumentation and a solid understanding of the extrusion process are important requirements for efficient troubleshooting. Instrumentation is very important in process control, but absolutely essential in troubleshooting. Without good instrumentation, troubleshooting is a guessing game at best, even when the troubleshooter fully understands the entire process. Thus, lack of instrumentation can prove very costly when it causes a particular problem to remain unsolved for even a limited length of time.

Important prerequisites to an efficient problem solving process are:

- Good instrumentation
- Good understanding of the extrusion process
- Collection and analysis of historical data
- Team building
- Good information about the condition of the equipment
- Good information about the feed stock

■ 1.1 Instrumentation

The extrusion process is, to a large extent, a black box process. It is not possible to visually observe what goes on inside the extruder. We can see material going into the extruder and material coming out of the extrusion die. However, what happens between the feed opening and the die exit cannot be seen in normal extruders because the process is obscured by the extruder barrel. Therefore, we are largely dependent on instrumentation to determine what happens inside the extruder. We can think of instrumentation as our “window to the process”. Because it is very

difficult to determine what is happening inside the extruder without good instrumentation, successful problem solving requires good instrumentation.

It is not sufficient to have ample instrumentation on the extruder; it is also important to confirm that the sensors and readouts are working correctly. For instance, if a temperature zone along the extruder is showing an excessively low or high temperature, we should verify that the temperature reading is correct. The measuring instruments must be correctly calibrated, and we should establish that the instrument is capable of measuring the variation of interest. In statistical process control (SPC), specific procedures have been developed to determine the capability of the measuring instrument [1].

■ 1.2 Understanding the Extrusion Process

A good understanding of the extrusion process is necessary to solve extrusion problems efficiently. It is recommended for the reader new to extrusion to take classes covering the material characteristics of plastics, typical features of extrusion machinery, instrumentation and operating controls, the inner workings of extruders, and screw and die design. Classes and continuing education short courses on extrusion are available from a variety of colleges and organizations. There are also a number of training programs available [2] as videos, interactive computer-based instruction, and web-based instruction.

In many extrusion operations, the primary mode of training is on-the-job training. However, on-the-job training is often the least effective and most expensive method of training. Extruders are expensive machines that must be operated correctly to produce good parts. If an extruder is not operated correctly, out-of-spec parts may be produced, or the extruder may be damaged. It is also important to realize that extruders are potentially dangerous devices. Serious accidents can occur when extruders are not operating properly. Therefore, it is imperative that people who operate extrusion equipment receive comprehensive safety training.

A short review of the extrusion process implies the understanding of the functional zones. The functional zones of a conventional single-screw extruder are shown in Figure 1.1:

- *feed hopper*, this zone is designed to operate under gravity flow and it feeds the granules or the particulate solids into the extruder,
- *solids conveying zone*, this zone is designed to transport and to slightly compress the granules or the particulate solids,

- *plasticating zone*, polymer melting takes place in this zone due to viscous dissipation and heat transfer by conduction from the extruder barrel,
- *melt conveying zone* (or *metering zone*), this zone is intended to transport the molten polymeric material and to achieve pressure buildup,
- *mixing zone*, this zone is designed to improve melt homogeneity by means of shear mixing elements, such as distributive, dispersive, or elongational mixers,
- *die forming*, the forming or shaping of the extrudate takes place in this zone for subsequent post-extrusion processes, such as calibration, cooling, winding or cutting, among others, and
- *venting*, this zone is only present in two-stage screw extruders or vented extruders and is used to remove any residual moisture or volatiles from the polymer melt.

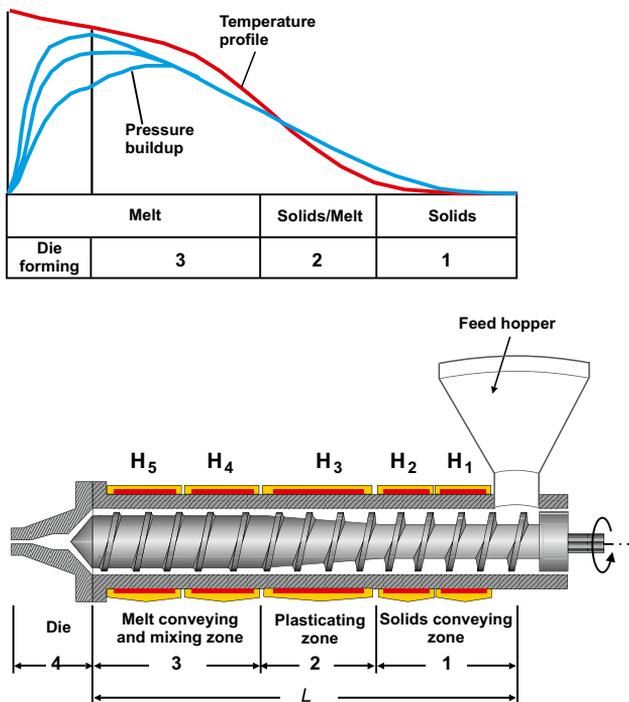


Figure 1.1 Functional zones in a single-screw extruder

■ 1.3 Collection and Analysis of Historical Data (Time Line)

To understand why a process is not behaving correctly, we must compare the current process conditions with previous conditions when the problem did not exist. This is known as constructing a time line. The data to be collected include not only process information from the extruder, such as temperatures, pressures, motor load, line speeds, barrel dimensions, screw dimensions, and such, but also information about the material as well as any other variables that can affect the process. Changes in the process can occur not only as a result of deviations in machine parameters, but also as a result of material variations. For instance, a change in the stabilizer level of the plastic can cause degradation problems in the absence of changes in the machine conditions and settings (Section 1.6).

The time line is constructed on the basis of the fact that the process was running well for a certain period of time. Therefore, there must be an identifiable change or changes that precipitated the process upset. The task is to identify these changes and correct them, and thus get the process back under control. The time line creation process starts during a period of process stability and ends some time after the problems in the process were noticed. All events even remotely connected to the process are listed on the time line. Once the time line is complete, it becomes a helpful tool for identifying the event that precipitated the problem.

It should be noted that not all events result in an immediate problem. In some cases there can be a considerable incubation time before the effects of a change become noticeable. This, of course, complicates the troubleshooting process; it is important to keep this in mind and not jump to conclusions. The author (CR) experienced a case when a disastrous wear problem was the result of an event that took place four months earlier. The wear remained insignificant until approximately four months after a new feed housing was installed. However, once rapid wear commenced, a screw was destroyed within 48 hours.

Figure 1.2 shows an example of a time line leading up to a gel problem. In constructing the time line, the troubleshooter should be sure to list all events that could potentially affect the process. Events such as a power outage, the installation of a new or refurbished extruder screw, or a new resin lot should obviously be included. Some events (such as construction in the area, changes in material handling, maintenance on the plant water system, operator training, or power surges) are less obvious but may still affect the process.

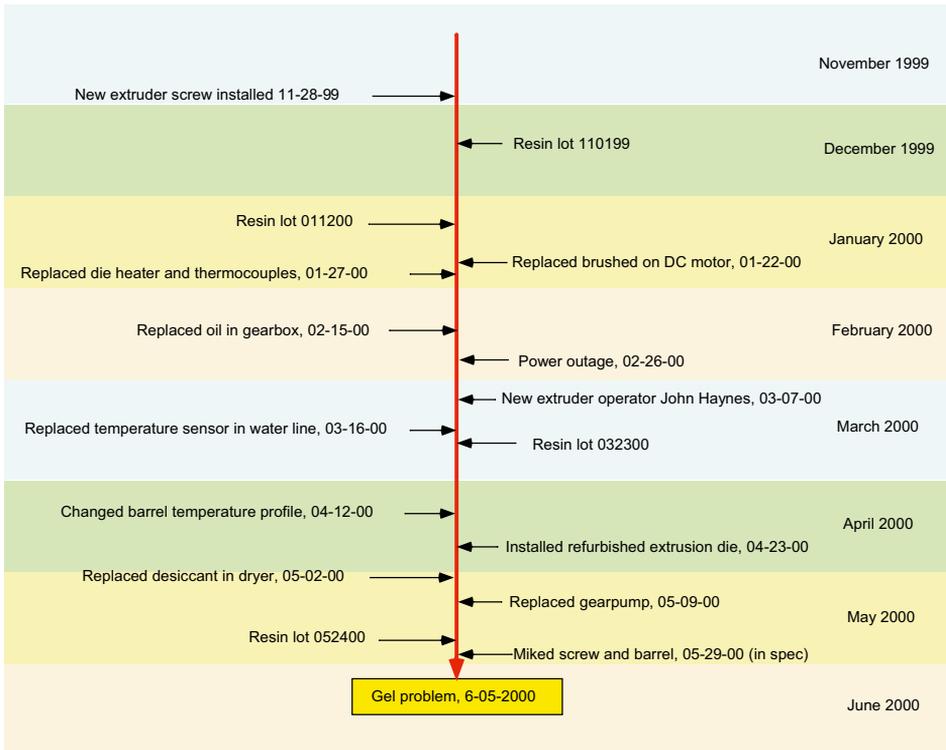


Figure 1.2 Example of a time line leading up to a gel problem

■ 1.4 Team Building

If the scope of a problem is small, a single individual can perform the problem-solving process, and there is no need to organize a team. In many cases, however, problems involve several different departments and functions and require a wide range of skills for solution. In such cases, a team effort is needed. Extrusion problems often require input from materials quality control (QC), purchasing, maintenance, engineering, and possibly from other departments.

■ 1.5 Condition of the Equipment

When a problem develops on an extruder, it is important to have good information on the condition of the equipment. Extruders should be well maintained, and good maintenance records should be available to assess the condition of the various components of the machine. Maintenance recommendations from the extruder manufacturer should be followed to ensure good performance.

Extruder screws and barrels will wear over time. The wear rate depends on many factors. Extruder screws can last for several years or only several weeks. It is important to measure the internal diameter (ID) of the barrel and the outer diameter (OD) of the screw on a regular basis, at least once a year, so that the life of the screw and barrel can be predicted. This allows the screw and the barrel to be replaced at predetermined intervals preventing unpleasant surprises.

■ 1.6 Information about the Feed Stock

The performance of an extruder is determined as much by the characteristics of the feed stock as by the characteristics of the machine. Feed stock properties that affect the extrusion process include bulk flow properties, melt flow properties, and thermal properties. Important bulk flow properties are the bulk density, compressibility, particle size, particle shape, external and internal coefficients of friction, and agglomeration tendency. Important melt flow properties are the shear and elongational viscosities as a function of strain rate and temperature. The commonly used melt indexer provides only limited information on the melt viscosity. Important thermal properties include the specific heat, the glass transition temperature, the crystalline melting point, the latent heat of fusion, the thermal conductivity, the density, the degradation temperature, and the induction time as a function of temperature.

In general, polymer material data is dependent on temperature and pressure. In other cases they are also dependent on surface roughness, sliding velocity, granulometry, shear rate, strain rate, and time. It is important to point out that thermal material data of polymers differ strongly depending on whether the polymer is an amorphous or a semi-crystalline material.

A change in the material can cause a problem in extrusion when it affects one or more polymer properties that determine the extrusion behavior of the material. If a material problem is suspected, the troubleshooter should first examine the QC records on incoming material to look for any record of a change in feed stock prop-

erties. Unfortunately, often, the only QC test on incoming material is a melt index (MI) test. This test detects only a very limited number of material-related extrusion problems. Thus, in many cases, more extensive material testing than the regular QC testing may be required.

There are a number of problems associated with making measurements on the critical properties of the feed stock. Approximately ten properties should be measured, and some of the measurements are fairly time-consuming. Thus, when a quick solution is required, it may take too much time to fully characterize the extrusion properties of a material. Another problem is that some important properties are difficult to measure with a high degree of accuracy and reproducibility. The most notable property in this category is the external coefficient of friction. Instruments to measure all the pertinent properties may not be readily available. Not all companies can afford to maintain a fully instrumented laboratory. Finally, even after a material is fully characterized, and no significant changes in properties have been found, there is no guarantee that the extrusion problem is not material-related. Because most tests are done on samples of about 0.01 kg or less, and most extruders run at a throughput of several hundred to several thousand kg/h, there is a considerable chance that the test sample may not have been representative of the entire feed stock.

A practical test for a material-related extrusion problem is to extrude some material from a previous batch to see if the problem will disappear. If this is indeed the case, it strongly indicates that the problem is material-related. For this reason, it is helpful to retain some material from older batches; this also provides a reference for more detailed measurements. If the problem is material-related, there are two possible solutions. The easiest solution is to change the material back to the way it was before the problem developed. However, this may not always be possible. Thus, if the material-related change is permanent, then the extrusion process will have to be adjusted to accommodate the material change. At this point, the nature of the problem may change from an upset to a development problem. The chance of solving the problem will depend on the nature and the magnitude of change in the material.

■ 1.7 Problem-Solving Techniques

When analyzing complex extrusion problems that appear to have many interconnected causes it is important to use a so-called *cause-effect* diagram. There are several possibilities to represent *cause-effect* diagrams, including fishbone diagrams or Ishikawa diagrams, problem tree diagrams, problem checklists, mind maps, concept maps, among others.

The fishbone was introduced by the Japanese professor Kaoru Ishikawa in 1943. The diagram is drawn with an arrow that will serve as the backbone from which further possible causes (bones) will be categorized and related. Occasionally, the detailed causes may come from other origins. The diagram allows the identification of potential causes for the problem and it helps to determine which ones are most likely resolve the problem.

A problem tree diagram is a way of visualizing the *cause-effect* relationships with regard to a specific technical problem. In such a representation the causes are shown at lower levels and the effects at upper levels. The problem tree diagram facilitates the organization of problems into a logical sequence which will lead to logical conclusions and the identification of technically cost-effective solutions.

The checklist is a very common tool and easy to apply to systems, projects, and problems. It is a list of activities to be noted, checked, or remembered. The objective is to ensure that a long list of tasks is not forgotten. In the plastics industry, checklists are used to check process compliance, to prevent failures or errors, to assure product quality, and to solve technical problems.

Mind mapping is also a useful technique for troubleshooting. This tool was developed by Tony Buzan in the 1970s. A mind map uses pictures and/or word phrases to organize and develop thoughts in a non-linear manner. The elements of a mind map are arranged intuitively according to the importance of the idea or task. The map allows establishment of connections that are not obvious. It helps to “observe” a problem and its solution.

A concept map is a diagram that allows visualizing of relationships among concepts. It is also a graphical tool and is normally used to represent knowledge. Concepts are represented as boxes and are connected with labeled arrows in a hierarchical structure. The relationship between concepts can be done with linking phrases. Figure 1.3 shows a concept map visualizing a whitening problem in a plastic product.

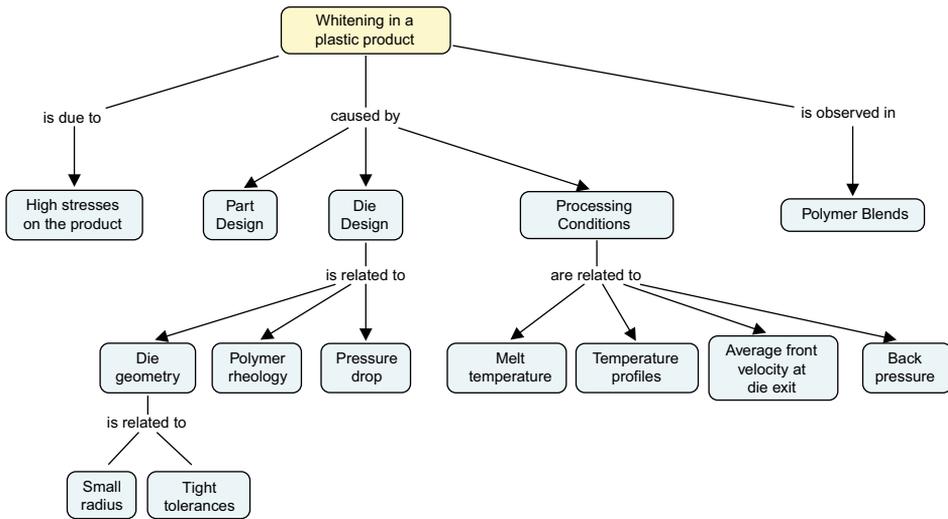


Figure 1.3 Example of a concept map visualizing a whitening problem

■ 1.8 Collection and Interpretation of Extrusion Process Data

1.8.1 Introduction

Many modern extrusion lines are equipped with data acquisition systems (DAS). These systems can present extruder operators and process engineers with a large amount of data. There are several critical issues in the proper use of a DAS:

- Are the correct process variables measured and monitored?
- Are these process variables measured correctly?
- Is the data collection rate appropriate?
- Is the operating personnel capable of proper interpretation of the data?

These issues will be addressed in this section.

1.8.2 Vital Signs of the Extrusion Process

The three most important extrusion process variables are melt pressure (P), melt temperature (T), and motor load (I). These three process variables are the vital signs of the extruder. When the extruder is not functioning correctly, one or two or

all three of these variables will show abnormal behavior. It is no coincidence that these three process variables are similar to the vital signs of the human body: blood pressure, body temperature, and pulse. The human body functions because the heart pumps blood through our vascular system. Blood pressure and pulse are measures of how well our blood is being pumped. In extrusion P, T, and I are measures of the pumping efficiency of the extruder.

One of the most important process measurements is the specific energy consumption (SEC). This is the motor power divided by the throughput. In the U.S. the SEC is typically expressed in units of $\text{hp}\cdot\text{h}/\text{lb}$ – more commonly, the SEC is expressed in $\text{kW}\cdot\text{h}/\text{kg}$. The SEC is a measure of the amount of energy from the motor introduced into the polymer. As a result, the SEC is closely related to the increase in stock temperature in the extrusion process. Higher levels of SEC lead to higher melt temperatures.

The minimum SEC needed to extrude a polymer is determined by the thermal properties. It is the specific heat multiplied by the temperature rise in the extrusion process – this is the increase in enthalpy. For semi-crystalline polymers the minimum SEC value is about $0.10 \text{ hp}\cdot\text{h}/\text{lb}$ or about $0.16 \text{ kW}\cdot\text{h}/\text{kg}$. It is good practice to monitor the SEC because it is a good measure of the energy efficiency of the extrusion process. If the SEC in a single-screw extrusion process is above $0.2 \text{ hp}\cdot\text{h}/\text{lb}$ ($0.32 \text{ kW}\cdot\text{h}/\text{kg}$), this indicates poor energy efficiency. This will likely result in high melt temperatures.

1.8.2.1 Melt Pressure

The most important process variable is melt pressure. Die inlet pressure is a direct measure of the flow rate through the die. Variation of die inlet pressure causes variation in flow rate; this, in turn, will cause dimensional variation of the extruded product, see Figure 1.4. A graphical display of die inlet pressure versus time provides a clear picture of the process stability – or lack thereof. A simple display of pressure (analog or digital) is much less useful.

When the extruder operator looks at a digital pressure readout with numbers typically changing ten times per second or more, it is impossible to get a clear picture of the pattern. The human mind has very limited ability to analyze large numbers of numerical data. On the other hand, when the operator can look at a graph of pressure versus time, the trend of the pressure pattern becomes immediately obvious. The human mind has remarkable ability to interpret graphical information. For this reason, trend plots are a very important element of a good DAS.

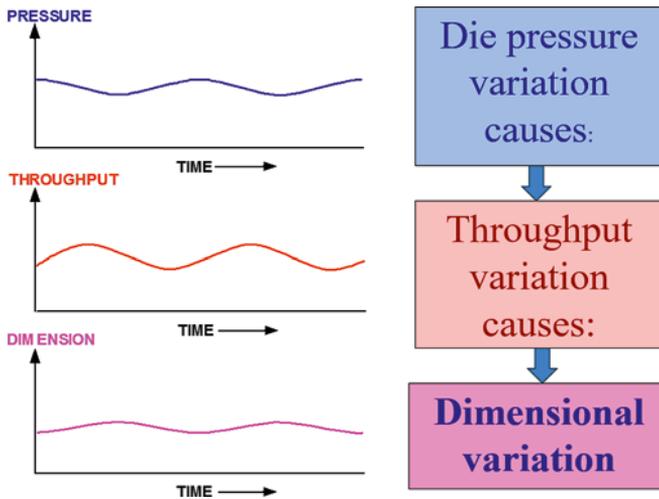


Figure 1.4 Effect of die inlet pressure variation on dimensional variation of extrudate

Pressure is measured with a pressure transducer. These pressure transducers have a thin diaphragm that is in contact with the molten plastic, see Figure 1.5.

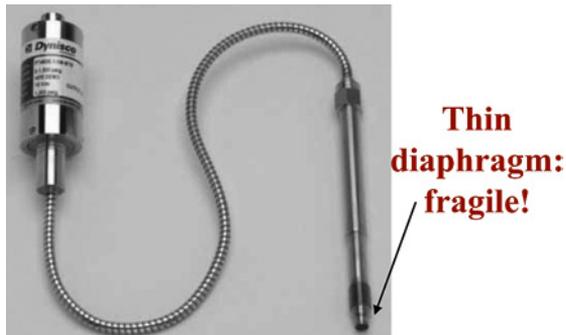


Figure 1.5 Typical pressure transducer

Increasing melt pressure will deflect this diaphragm and this deflection is a measure of the amount of pressure acting on the diaphragm. There are several different types of pressure transducers. Table 1.1 lists several types with a comparison in terms of robustness, maximum temperature, dynamic response, and error.